

INSTALLATION NOTES

FOR INSTALLATION IN SHEET METAL HOOD AND DUCTS ONLY

MINIMUM SHEET THICKNESS: 0.020 (25 GA.)

MAXIMUM SHEET THICKNESS: 0.080 (14 GA.)

HOLE DIAMETER: (WITH "Q" DRILL - P/N QDRILL): 0.332/0.338


TO BE INSTALLED ONLY WITH BROOKS TOOL (P/N QMTOOL)

INSTALLATION INSTRUCTIONS


1. Drill hole with "Q" size drill.
2. Spread levers on QMTOOL apart and pull ball-tipped spindle out fully.
3. Install QUICK-MOUNT on mandrel and push in ball-tipped spindle.
4. Insert QUICK-MOUNT on mandrel in drilled hole.
5. Press levers together to clinch QUICK-MOUNT.
6. Pull ball tipped spindle out to release QUICK-MOUNT.
7. Check QUICK-MOUNT for tightness. If necessary, reset QMTOOL and reclinch QUICK-MOUNT.

QMTOOL SET-UP

1. Bring levers of tool together.
2. Turn numbered bushing so "0" is in line with the red mark.

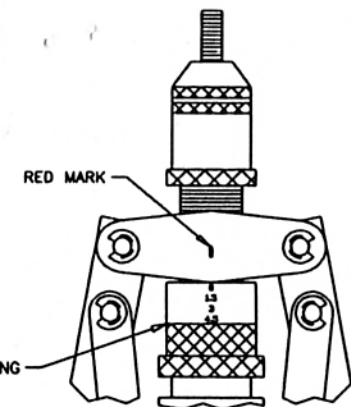

3. Turn bushing 2-2/3 turns counterclockwise.
4. Number "4" is now in line with red mark.
5. Tighten locknut.

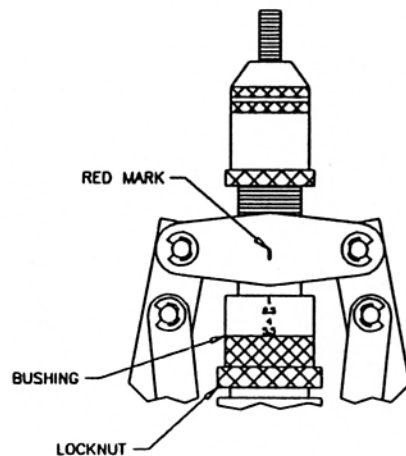

6. Spread levers fully apart.
7. Adjust nose-piece of tool so that 11/16-3/4" of threaded mandrel extends.
8. Tighten lock nut. Tool is ready to set QUICK-MOUNT FASTENERS.

